




TEST CERTIFICATE

56/93873

Site Number 840-Emirates Auctions Transaction Date 14 Sep 2024, 10:19:46
 Transaction Number 33844795 (CC10006) (CC10006) Queue Number 1058081

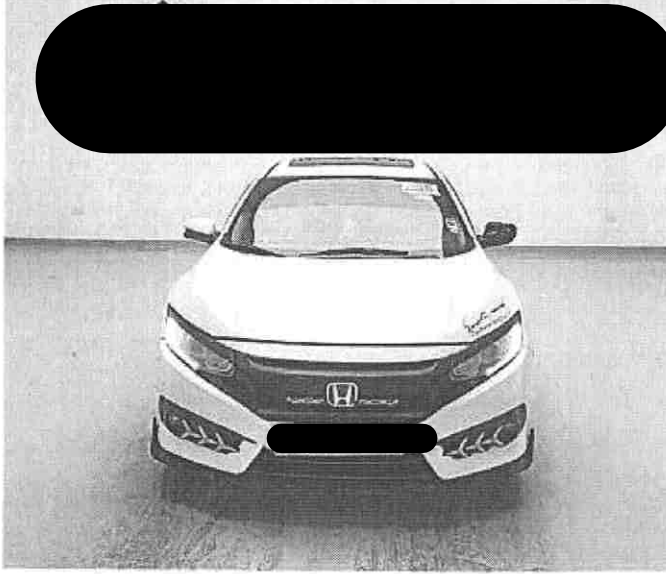

Chassis Number 19XFC2F73JE027820
 Engine Number
 Vehicle Class Car
 Manufacturer Honda
 Model Civic
 Model Year 2018
 Color White
 Mileage 199417 Km
 Fuel Type Petrol
 No. Of Cylinders 4
 Specification Imported

DEFECT

REMARKS

01 Body

جسم المركبة

01.A Fenders	REFITTED, REPAINTED, PORTION REPAIRED	مدكار
01.B Paint	BODY PORTION REPAINTED , PORTION REPAIRED , DENTS & SCRATCHES , PORTION FADED , PORTION RUSTY	الصبغ
01.C Doors	REPAINTED, PORTION REPAIRED	أبواب
01.D Rusty	UNDER BODY PARTS, SUSPENTION GETTING RUSTY	صدأ
01.E Bumper	MISALIGN, MODIFIED	دعامية
01.F Bonnet	REFITTED, REPAINTED, PORTION REPAIRED	غطاء المحرك
01.G Other	FRONT FENDER FRAME, BUMPER FRAME ,BULKHEAD, RADIATOR SUPPORT REPAIRED	أخري
01.H Trunk	SPOYLER MODIFIED (BLACK STICKER)	صندوق
01.I Sign of side accident		وجود مؤشر لحادث في الجانب

02 Chassis Condition

الشاسي

02.A Chassis	COVERD, CHECKED VISIBLE AREA ONLY, LEFT SIDE MIONR DENT	النشاسيه
--------------	---	----------

03 Engine Condition

المحرك

03.A Smoke	MINOR BLACK SMOKE	دخان
03.B Engine Visual Condition	REFITTED, OIL WET, SHAKING	الحالة النظرية للمحرك

DEFECT	REMARKS	
04 Transmission Condition		الجير
04.A Gear Box Visual Condition	REFITTED, OIL WET, JERKING	الحالة النظرية للجير
04.B Gear Box Mount	BUSH CRACKED	كرسي الجير
04.C Road Test	NOT CHECK	فحص على الطريق
05 Tires and Rims Condition		الاطارات
05.A Front Tyre	BOTH SIDE 2022	الاطار الامامي
05.B Rear Tyre	BOTH SIDE 2022	الاطار الخلفي
06 Lights		الاضاءة
06.A Head Light	LENS FADED	الاضاءة الرئيسية
06.B Warning Light	WARNING LIGHT ON IN DISPLAY	ضوء تحذير
07 Suspension System		ممتص الصدمات
07.A Arms	LOWER ARM BUSHES CRACKED	الزرع
08 Interior Condition		الحالة الداخلية
08.A Mirror	LEFT SIDE COVER MISSING	المرآيا
08.B AC Condition	NOT COOLING	المكيف
08.C Power Window Switch And Glass	REAR LEFT SIDE & RIGHT SIDE BOTH NOT WORKING, BUTTON FADED	مفتاح النافذة و الزجاج
08.D Roof Ceiling	PORTION LOOSE	بطانة السقف
08.E Sunroof	BUTTON SWITCH PORTION DAMAGED	فئحت سقف

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.
- For complaints and inquiries reach out to us on wecare@carscheck.ae



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، وبعتبر الفحص في هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من بعده.
- للشكاوي والمقترحات يمكنك التواصل معنا عبر wecare@carscheck.ae