




TEST CERTIFICATE

Site Number **840-Emirates Auctions** Transaction Date **21 Sep 2024, 12:59:29**
 Transaction Number **86666757 (CC10008) (CC10010)** Queue Number **1058104**

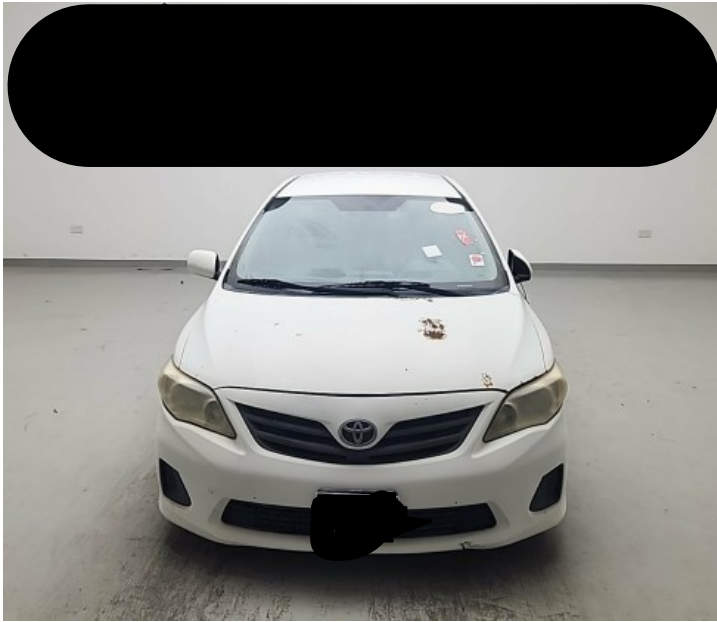

Chassis Number **RKLBV42E0D4644223**
 Engine Number
 Vehicle Class **Car**
 Manufacturer **Toyota**
 Model **Corolla**
 Model Year **2013**
 Color **White**
 Mileage **132693 Km**
 Fuel Type **Petrol**
 No. Of Cylinders **4**
 Specification **GCC Specification**

DEFECT	REMARKS	
01 Body		جسم المركبة
01.A Paint	BODY PORTION REPAINTED ,PORTION REPAIRED ,DENTS SCRATCHES ,PORTION RUSTY ,PORTION FADED.	الصبغ
01.B Rusty	UNDER BODY SUSPENSION PARTS GETTING RUSTY .	صدأ
01.C Floor	PORTION DENT .	الارضية
01.D Bumper	MISALIGN ,PORTION DAMAGED .	دعامية
01.E Other	FRONT BUMPER FRAME ,FENDER FRAME ,BULKHEAD ,RADIATOR SUPPORT ,CROSS MEMBER REPAIRED.	اخرى
01.F Sign of front accident		وجود مؤشر لحادث في المقدمة
02 Chassis Condition		الشاسي
02.A Chassis	OK PORTION RUSTY .	الشاسيه
03 Engine Condition		المحرك
03.A Mount	BUSHES CRACKED .	كرسي
03.B Smoke	WHITE SMOKE .	دخان
03.C Engine Visual Condition	ABNORMAL NOISY ,COMPONENT PARTS GETTING RUSTY ,MISFIRING ,SHAKING ,MINOR OIL LEAK .	الحالة النظرية للمحرك
04 Transmission Condition		الجير

DEFECT	REMARKS	
04.A Gear Box Visual Condition	JERKING MINOR OIL LEAK .	الحالة النظرية للجير
04.B Gear Box Mount	BUSHES CRACKED .	كرسي الجير
04.C Road Test	NOT CHECKED .	فحص علي الطريق
05 Lights		الاضاءة
05.A Head Light	LENS FADE ,NOT WORKING PROPERLY .	الاضاءة الرئيسية
05.B Warning Light	WARNING LIGHT ON IN CLUSTER.	ضوء تحذير
06 Brake Condition		الفرامل
06.A Brake Pedal	SPONGY.	دواسة الفرامل
06.B Disc&Drum	RUSTY .	دسك و طنابير الفرامل
07 Suspension System		ممتص الصدمات
07.A Shock Absorber	LEAK WEAK .	ممتص الصدمات
07.B Arms	BUSHES CRACKED ,	ازرع
08 Interior Condition		الحالة الداخلية
08.A AC Condition	NO COOLKNG .	المكيف
08.B Power Window Switch And Glass	NOT WORKING PROPERLY .	مفتاح النافذه و الزجاج
08.C Dash Board	MELTED .	لوحة القيادة
08.D Sun Visor	LOOSE .	حاجب الشمس
08.E Steering Wheel and control buttons	WORN OUT .	عجلة القيادة وازرار التحكم
08.F Gear Shifting Lever	KNOB WORN OUT .	ذراع نقل السرعات

- The inspection report is valid and shows the vehicle's condition at the time of the inspection only. Car Check doesn't guarantee the vehicle's condition as soon as it leaves the inspection station, and from then on, the inspection is considered invalid.
- Car Check is not responsible for hidden defects of the vehicle, and according to this certificate, Car Check does not guarantee the vehicle's fitness for registration.
- For complaints and inquiries reach out to us on wecare@carscheck.ae



- شهادة الفحص سارية وتظهر حالة المركبة وقت الفحص فقط، ولا تضمن كار تشيك حالة المركبة بمجرد خروجها من محطة الفحص، ويعتبر الفحص في هذه الحالة غير ساري.
- كار تشيك غير مسؤولة عن العيوب الخفية في المركبة، كما لا تضمن بموجب هذه الشهادة صلاحية المركبة للتسجيل من عدمه.
- للشكاوي والمقترحات يمكنك التواصل معنا عبر wecare@carscheck.ae